

Agilent U1270 Series Handheld Digital Multimeters

Data Sheet

NEW



Features

- OLED display for high brightness level and wider viewing angles (up to 160 degrees)¹
- Intelligent features: $Z_{\text{LOW}}^{1,2}$, Smart $\Omega^{1,2}$, Low Pass Filter, Qik-V³
- Visual (Backlight³ and Symbol¹ Alert) and audible continuity indication in noisy environments
- Ergonomic shape for better grip
- IP 54 certified – water and dust resistant
- 30,000-count dual display
- AC + DC capability^{1,2}
- CAT III 1000 V, CAT IV 600 V safety rating
- Easy maintenance – convenient fuse access
- Easy connectivity to PC with optional IR-USB cable
- Internal memory for data logging

1. U1273A
2. U1272A
3. U1271A

OLED for more display clarity

The U1273A, the latest addition to U1270 series, comes with an OLED display that has outstanding contrast levels and high brightness levels. The display also allows wider viewing angles up to 160 degrees to ensure that you get the right readings at the first glance.

Get a better grip on your DMM

The U1270 series is shaped perfectly to fit in your hand, with or without gloves on. Its non-slip ergonomic shape enables you to carry your DMM and perform measurements on the go easily. Additionally, the controls are easy to operate due to the large knob and buttons.

Improve productivity with intelligent features

Designed for maximum efficiency and productivity in industrial settings,

these DMMs offer convenient functions such as Z_{LOW} to eliminate stray voltages, **Smart Ω** to minimize false readings due to leakage current and **Qik-V** to determine existence of AC and/or DC voltages.

Continuity detection in noisy and dark places is made easy with the U1270 series' loud beeper and **Visual Alert** function that indicates continuity and improves safety.

When it comes to Variable Frequency Drive (VFD) troubleshooting, the U1270 series has **Low Pass Filter** to handle the job with ease.

Water and dust resistant

The series' tightly sealed design helps protect against water, dust and damage. Each DMM is IP 54 certified so that you can carry out test and measurement with confidence, even in harsh working conditions.



Agilent Technologies

Key Functions

Low Impedance (Z_{LOW})

The U1272A and U1273A are dual input impedance digital multimeters. The DMM's high input impedance is preferred in most electrical measurements because it would not load the circuit under test. However, to obtain accurate measurements on circuits that may contain stray voltages, the U1272A and U1273A's 2 k Ω low impedance function comes

in handy. Stray voltages are usually found in non-energized electrical wiring adjacent to powered wires due to capacitive or inductive coupling between these wires. When a pair of test leads is placed between the open circuit and neutral conductor, the circuit is then complete and forms a voltage divider in conjunction with the input impedance of the multimeter.

High input impedance multimeter is sensitive enough to measure voltage coupled into the disconnected conductor, thus giving an inaccurate indication of a live conductor. The low impedance function serves to eliminate false readings by dissipating the stray voltages, thus improves safety and measurement efficiency during voltage.



Figure 1. U1272A helps you identify the presence of stray voltage on a disconnected wire running parallel with the wire powering up the VFD to an industrial motor. The image on the right shows the U1272A in low impedance mode.

Key Functions

Low Pass Filter (LPF)

The U1270 series offers a 1 kHz LPF or Low Pass Filter to provide accurate Variable Frequency Drive (VFD) output measurement. This function eliminates

high frequency noise and harmonics. This ensures the efficiency of your motor filter as well.



Figure 2. Comparison of voltage output from industrial motor VFD without and with Low Pass Filter functionality.

Smart Ω

The U1272A and U1273A provide an additional 30 Ohm range for low resistance measurement. This Smart Ω function is available for ranges of 30 Ohm to 300 kOhm. It enhances measurement accuracy with offset compensation by removing residual DC voltages of up to 1000 mV induced

by ground current and thermal EMF. This function also enables 'live' resistance measurement without isolating the measurement circuit. With this, you will be able to obtain leakage current using the secondary display.

Front and Back Panel Description



1. U1272A and U1273A only

Front and Back Panel Description



Choose Among These Three Models

	U1271A	U1272A	U1273A	
Basic Features				
Display resolution	30,000	30,000	30,000	
Auto/manual ranging	Yes	Yes	Yes	
Analog bar graph	Yes	Yes	Yes	
Backlight	Yes	Yes	—	
AC bandwidth	20 kHz	100 kHz	100 kHz	
True RMS	AC	AC + DC	AC + DC	
Measurements				
Voltage DC	Range Accuracy	300 mV to 1000 V 0.05% + 2 cnts	30 mV to 1000 V 0.05% + 2 cnts	30 mV to 1000 V 0.05% + 2 cnts
Voltage AC	Range Accuracy Bandwidth	300 mV to 1000 V 0.7% + 20 cnts 45 Hz to 20 kHz	30 mV to 1000 V 0.6% + 20 cnts 45 Hz to 100 kHz	30 mV to 1000 V 0.6% + 20 cnts 45 Hz to 100 kHz
Current DC	Range Accuracy	300 µA to 10 A 0.2% + 5 cnts	300 µA to 10 A 0.2% + 5 cnts	300 µA to 10 A 0.2% + 5 cnts
Current AC	Range Accuracy Bandwidth	300 µA to 10 A 0.9% + 25 cnts 45 Hz to 2 kHz	300 µA to 10 A 0.6% + 25 cnts 45 Hz to 2 kHz	300 µA to 10 A 0.6% + 25 cnts 45 Hz to 2 kHz
Resistance	Range Accuracy	300 Ω to 100 MΩ 0.2% + 5 cnts	30 Ω to 300 MΩ 0.2% + 5 cnts	30 Ω to 300 MΩ 0.2% + 5 cnts
Frequency	Range Accuracy	99.999 Hz to 999.99 kHz 0.005% + 5 cnts	99.999 Hz to 999.99 kHz 0.005% + 5 cnts	99.999 Hz to 999.99 kHz 0.005% + 5 cnts
Capacitance	Range Accuracy	10 nF to 10 mF 1% + 2 cnts	10 nF to 10 mF 1% + 2 cnts	10 nF to 10 mF 1% + 2 cnts
Temperature	Range Accuracy	K: -200 to 1372 °C 1% + 1 °C	K: -200 to 1372 °C J: -210 to 1200 °C 1% + 1 °C	K: -200 to 1372 °C J: -210 to 1200 °C 1% + 1 °C
Continuity with beeper		Yes	Yes	Yes
Diode test		Yes	Yes	Yes
Data Management				
Min/Max Recording		Yes	Yes	Yes
Display Hold		Yes	Yes	Yes
Peak Hold		Yes	Yes	Yes
Datalogging		Manual: 100 points Interval: 200 points	Manual: 100 points Interval: 10,000 points	Manual: 100 points Interval: 10,000 points
Null		Yes	Yes	Yes
PC Connectivity		IR-USB	IR-USB	IR-USB
% scale of 4-20 mA		Yes	Yes	Yes

Choose Among These Three Models

	U1271A	U1272A	U1273A
Special Features			
OLED display	—	—	Yes
Alert in continuity test	Beep + Backlight Alert	Beep + Backlight Alert	Beep + Symbol Alert
Low Pass Filter (LPF)	Yes	Yes	Yes
Z_{LOW} - Low impedance mode	—	Yes	Yes
Smart Ω	—	Yes	Yes
Qik-V	Yes	—	—
Safety and Regulatory			
Over-voltage safety protection	CAT III 1000 V, CAT IV 600 V	CAT III 1000 V, CAT IV 600 V	CAT III 1000 V, CAT IV 600 V
EN/IEC 61010-1:2001 compliance	Yes	Yes	Yes
General			
Battery	4x AAA	4x AAA	4x AAA
Operating temperature	−20 °C to 55 °C, 0 to 80% RH	−20 °C to 55 °C, 0 to 80% RH	−20 °C to 55 °C, 0 to 80% RH
Standard accessories	Standard test leads, test probes with 4-mm tips, K-type thermocouple and adapter, 4x AAA batteries, Certificate of Calibration, UK 6 (test report), Quick Start Guide	Standard test leads, test probes with 4-mm tips, K-type thermocouple and adapter, 4x AAA batteries, Certificate of Calibration, UK 6 (test report), Quick Start Guide	Standard test leads, test probes with 4-mm tips, K-type thermocouple and adapter, 4x AAA batteries, Certificate of Calibration, UK 6 (test report), Quick Start Guide

General Specifications

Display	<ul style="list-style-type: none"> U1271A and U1272A: Liquid crystal display (LCD) (with maximum reading of 33,000 counts) U1273A: Organic LED (OLED) display (with maximum reading of 33,000 counts)
Power consumption	<ul style="list-style-type: none"> U1271A/U1272A: 460 mVA maximum (with backlight enabled) U1273A: 180 mVA maximum (with maximum brightness)
Battery type	<ul style="list-style-type: none"> 4 x 1.5 V Alkaline battery (ANSI/NEDA 24A or IEC LR03), or 4 x 1.5 V Zinc Chloride battery (ANSI/NEDA 24D or IEC R03)
Battery life	<ul style="list-style-type: none"> U1271A and U1272A: 300 hours typical (based on new Alkaline batteries for DC voltage measurement) U1273A: 30/45/60 hours typical (based on new Alkaline batteries for DC voltage measurement at High/Medium/Low brightness, respectively) Low battery indicator will flash when the battery voltage drops below 4.4 V (approximately)
Fuse	<ul style="list-style-type: none"> 10 x 35 mm 440 mA/1000 V 30 kA fast-acting fuse 10 x 38 mm 11 A/1000 V 30 kA fast-acting fuse
Operating environment	<ul style="list-style-type: none"> Operating temperature from –20 to 55 °C, 0 to 80% RH Full accuracy up to 80% RH for temperatures up to 30 °C, decreasing linearly to 50% RH at 55 °C Altitude up to 2000 meters Pollution degree II
Storage compliance	–40 to 70 °C, 0 to 80% RH
Safety compliance	<ul style="list-style-type: none"> CAN/CSA-C22.2 No. 61010-1-04 EN/IEC 61010-1:2001 ANSI/UL 61010-1:2004
Measurement category	CAT III 1000 V/CAT IV 600 V
Electromagnetic compatibility (EMC)	Commercial limits compliance with EN61326-1
Ingress protection rating	IP-54
Temperature coefficient	0.05 × (specified accuracy) / °C (from –20 to 18 °C, or 28 to 55 °C)
Common Mode Rejection Ratio (CMRR)	> 120 dB at DC, 50/60 Hz ± 0.1% (1 kΩ unbalanced)
Normal Mode Rejection Ratio (NMRR)	> 60 dB at 50/60 Hz ± 0.1%
Dimensions (W x H x D)	92 × 207 × 59 mm
Weight	<ul style="list-style-type: none"> U1271A: 518 grams (with batteries) U1272A: 520 grams (with batteries) U1273A: 500 grams (with batteries)
Warranty	<ul style="list-style-type: none"> Three years for product Three months for product's accessories
Calibration cycle	One year

Specification Assumptions

- Accuracy is given as \pm (% of reading + counts of least significant digit) at $23^\circ\text{C} \pm 5^\circ\text{C}$, with relative humidity less than 80% RH.
- AC V and AC $\mu\text{A}/\text{mA}/\text{A}$ specifications are AC coupled, true RMS and are valid from 5% of range to 100% of range.
- The crest factor may be up to 3.0 at full scale except for the 1000 V range where it is 1.5 at full scale.
- For non-sinusoidal waveforms, add (2% reading + 2% full scale) typical, for crest factors up to 3.
- After Z_{LOW} voltage measurements, wait at least 20 minutes for thermal impact to cool before proceeding with any other measurement.

Electrical Specifications

DC specifications for U1271A, U1272A, and U1273A

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)			Test current/ Burden voltage
			U1271A	U1272A	U1273A	
Voltage ¹	30 mV	0.001 mV	—	0.05 + 20	0.05 + 20	—
	300 mV	0.01 mV	0.05 + 5	0.05 + 5	0.05 + 5	—
	3 V	0.0001 V	0.05 + 5	0.05 + 5	0.05 + 5	—
	30 V	0.001 V	0.05 + 2	0.05 + 2	0.05 + 2	—
	300 V	0.01 V	0.05 + 2	0.05 + 2	0.05 + 2	—
	1000 V	0.1 V	0.05 + 2	0.05 + 2	0.05 + 2	—
	Z_{LOW} (low input impedance) enabled, applicable for 1000 V range and resolution only	0.1 V	—	1 + 20	1 + 20	—
Resistance ²	30 Ω	0.001 Ω	—	0.2 + 10	0.2 + 10	0.65 mA
	300 Ω	0.01 Ω	0.2 + 5	0.2 + 5	0.2 + 5	0.65 mA
	3 k Ω	0.0001 k Ω	0.2 + 5	0.2 + 5	0.2 + 5	65 μ A
	30 k Ω	0.001 k Ω	0.2 + 5	0.2 + 5	0.2 + 5	6.5 μ A
	300 k Ω	0.01 k Ω	0.5 + 5	0.5 + 5	0.5 + 5	0.65 μ A
	3 M Ω	0.0001 M Ω	0.6 + 5	0.6 + 5	0.6 + 5	93 nA/10 M Ω
	30 M Ω	0.001 M Ω	1.2 + 5	1.2 + 5	1.2 + 5	93 nA/10 M Ω
	100 M Ω	0.01 M Ω	2.0 + 10	—	—	93 nA/10 M Ω
	300 M Ω	0.01 M Ω	—	2.0 + 10 @ < 100 M Ω 8.0 + 10 @ > 100 M Ω	2.0 + 10 @ < 100 M Ω 8.0 + 10 @ > 100 M Ω	93 nA/10 M Ω
	300 nS	0.01 nS	1 + 10	1 + 10	1 + 10	93 nA/10 M Ω
Current ³	300 μ A	0.01 μ A	0.2 + 5	0.2 + 3	0.2 + 5	< 0.04 V/100 Ω
	3000 μ A	0.1 μ A	0.2 + 5	0.2 + 3	0.2 + 5	< 0.4 V/100 Ω
	30 mA	0.001 mA	0.2 + 5	0.2 + 3	0.2 + 5	< 0.08 V/1 Ω
	300 mA	0.01 mA	0.2 + 5	0.2 + 3	0.2 + 5	< 1.00 V/1 Ω
	3 A	0.0001 A	0.3 + 10	0.3 + 10	0.3 + 10	< 0.1 V/0.01 Ω
	10 A	0.001 A	0.3 + 10	0.3 + 10	0.3 + 10	< 0.3 V/0.01 Ω
Diode Test ⁴	3 V	0.0001 V	0.5 + 5	0.5 + 5	0.5 + 5	Approximately 1 to 2 mA
	Auto	0.0001 V	—	0.5 + 5	0.5 + 5	Approximately 0.1 to 0.3 mA

See notes on next page.

Electrical Specifications

Notes for DC specifications (previous page)

1. Notes for voltage specifications:

- The accuracy of the 30 to 300 mV range is specified after the Null function is used to subtract the thermal effect (by shorting the test leads).
- For Z_{LOW} measurements, autoranging is disabled and the multimeter's range is set to 1000 volts in the manual ranging mode.

2. Notes for resistance specifications:

- Overload protection: 1000 Vrms for short circuits with < 0.3 A current.
- Maximum open voltage is $< +3.3$ V.
- Built-in buzzer beeps when the resistance measured is less than $25 \Omega \pm 10 \Omega$. The multimeter can capture intermittent measurements longer than 1 ms.
- The accuracy of the 300 Ω to 3 k Ω range is specified after the Null function is used to subtract the test lead resistance and thermal effect (by shorting the test leads).
- For the ranges of 30 M Ω and 100 M Ω , the RH is specified for $< 60\%$.
- The accuracy for ranges < 50 nS is specified after the Null function is used on an open test lead.
- The temperature coefficient of the 100 M Ω and 300 M Ω range is $0.1 \times (\text{specified accuracy})/{}^{\circ}\text{C}$ (from -20 ${}^{\circ}\text{C}$ to 18 ${}^{\circ}\text{C}$ or 28 ${}^{\circ}\text{C}$ to 55 ${}^{\circ}\text{C}$).

3. Notes for current specifications:

- Overload protection for 300 μ A to 300 mA range: 0.44 A/1000 V; 10 \times 35 mm 30 kA fast-acting fuse.
- Overload protection for 3 A to 10 A range: 11 A/1000 V; 10 \times 38 mm 30 kA fast-acting fuse.
- Specification for 300 mA range: 440 mA continuous.
- Specification for 10 A range: 10 A continuous. Add 0.3% to the specified accuracy when measuring signals > 10 to 20 A for 30 seconds maximum. After measuring currents > 10 A, cool down the multimeter for twice the duration of the measured time before proceeding with low current measurements.

4. Notes for diode specifications:

- Overload protection: 1000 Vrms for short circuits with < 0.3 A current.
- Built-in buzzer beeps continuously when the voltage measured is less than 50 mV and beeps once for forward-biased diode or semiconductor junctions measured between 0.3 V and 0.8 V (0.3 V \leq reading ≤ 0.8 V).
- Open voltage for diode: $< +3.3$ V DC.
- Open voltage for Auto diode: $< +2.5$ V DC and > -1.0 V DC.

Electrical Specifications

AC specifications for U1271A

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)			
			45 Hz to 65 Hz	30 Hz to 1 kHz	1 kHz to 5 kHz	5 kHz to 20 kHz
True RMS AC Voltage ¹	300 mV	0.01 mV	0.7 + 20	1.0 + 25	2.0 + 25	2.0 + 40
	3 V	0.0001 V	0.7 + 20	1.0 + 25	2.0 + 25	2.0 + 40
	30 V	0.001 V	0.7 + 20	1.0 + 25	2.0 + 25	2.0 + 40
	300 V	0.01 V	0.7 + 20	1.0 + 25	2.0 + 25	—
	1000 V	0.1 V	0.7 + 20	1.0 + 25	—	—
	LPF (low pass filter) enabled, applicable for all voltage ranges and resolution		0.7 + 20	1.0 + 25 @ < 200 Hz 5.0 + 25 @ < 440 Hz	—	—

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)	Burden voltage/Shunt
			45 Hz to 2 kHz	
True RMS AC Current ²	300 μ A	0.01 μ A	0.9 + 25	< 0.04 V/100 Ω
	3000 μ A	0.1 μ A	0.9 + 25	< 0.4 V/100 Ω
	30 mA	0.001 mA	0.9 + 25	< 0.08 V/1 Ω
	300 mA	0.01 mA	0.9 + 25	< 1.00 V/1 Ω
	3 A	0.0001 A	1.0 + 25	< 0.1 V/0.01 Ω
	10 A	0.001 A	1.0 + 25	< 0.3 V/0.01 Ω

1. Notes for voltage specifications:

- Overload protection: 1000 Vrms. For millivolt measurements, 1000 Vrms for short circuits with < 0.3 A current.
- Input impedance: 10 M Ω (nominal) in parallel with < 100 pF.

2. Notes for current specifications:

- Overload protection for 300 μ A to 300 mA range: 0.44 A/1000 V; 10 \times 35 mm 30 kA fast-acting fuse.
- Overload protection for 3 A to 10 A range: 11 A/1000 V; 10 \times 38 mm 30 kA fast-acting fuse.
- Specification for 300 mA range: 440 mA continuous.
- Specification for 10 A range: 10 A continuous. Add 0.3% to the specified accuracy when measuring signals > 10 to 20 A for 30 seconds maximum. After measuring currents > 10 A, cool down the multimeter for twice the duration of the measured time before proceeding with low current measurements.

Electrical Specifications

AC specifications for U1272A and U1273A

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)				
			45 Hz to 65 Hz	20 Hz to 1 kHz	1 kHz to 5 kHz	5 kHz to 20 kHz	20 kHz to 100 kHz
True RMS AC Voltage ¹	30 mV	0.001 mV	0.6 + 20	0.7 + 25	1.0 + 25	1.0 + 40	3.5 + 40
	300 mV	0.01 mV	0.6 + 20	0.7 + 25	1.0 + 25	1.0 + 40	3.5 + 40
	3 V	0.0001 V	0.6 + 20	1.0 + 25	1.5 + 25	2.0 + 40	3.5 + 40
	30 V	0.001 V	0.6 + 20	1.0 + 25	1.5 + 25	2.0 + 40	3.5 + 40
	300 V	0.01 V	0.6 + 20	1.0 + 25	1.5 + 25	2.0 + 40	—
	1000 V	0.1 V	0.6 + 20	1.0 + 25	1.5 + 25	—	—
	LPF (low pass filter) enabled, applicable for all voltage ranges and resolution		0.6 + 20	1.0 + 25 @ < 200 Hz 5.0 + 25 @ < 440 Hz	—	—	—
	Z_{LOW} 1000 V		2.0 + 40	2 + 40 @ < 440 Hz	—	—	—

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)		Burden voltage/Shunt
			45 Hz to 65 Hz	20 Hz to 2 kHz	
True RMS AC Current ²	300 μ A	0.01 μ A	0.6 + 25	0.9 + 25	< 0.04 V/100 Ω
	3000 μ A	0.1 μ A	0.6 + 25	0.9 + 25	< 0.4 V/100 Ω
	30 mA	0.001 mA	0.6 + 25	0.9 + 25	< 0.08 V/1 Ω
	300 mA	0.01 mA	0.6 + 25	0.9 + 25	< 1.00 V/1 Ω
	3 A	0.0001 A	0.8 + 25	1.0 + 25	< 0.1 V/0.01 Ω
	10 A	0.001 A	0.8 + 25	1.0 + 25	< 0.3 V/0.01 Ω

1. Notes for voltage specifications:

- Overload protection: 1000 Vrms. For millivolt measurements, 1000 Vrms for short circuits with < 0.3 A current.
- Input impedance: 10 M Ω (nominal) in parallel with < 100 pF.
- Z_{LOW} impedance: 2 k Ω (nominal).
- The input signal is lower than the product of 20,000,000 V \times Hz.
- For 20 to 100 kHz accuracy: Three counts of the LSD per kHz of additional error is to be added for frequencies > 20 kHz and signal inputs < 10% of range.

2. Notes for current specifications:

- Overload protection for 300 μ A to 300 mA range: 0.44 A/1000 V; 10 \times 35 mm 30 kA fast-acting fuse.
- Overload protection for 3 A to 10 A range: 11 A/1000 V; 10 \times 38 mm 30 kA fast-acting fuse.
- Specification for 300 mA range: 440 mA continuous.
- Specification for 10 A range: 10 A continuous. Add 0.3% to the specified accuracy when measuring signals > 10 to 20 A for 30 seconds maximum. After measuring currents > 10 A, cool down the multimeter for twice the duration of the measured time before proceeding with low current measurements.

Electrical Specifications

AC + DC specifications for U1272A and U1273A

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)				
			45 Hz to 65 Hz	20 Hz to 1 kHz	1 kHz to 5 kHz	5 kHz to 20 kHz	20 kHz to 100 kHz
True RMS AC + DC Voltage ¹	30 mV	0.001 mV	0.7 + 40	0.8 + 45	1.1 + 45	1.1 + 60	3.6 + 60
	300 mV	0.01 mV	0.7 + 25	0.8 + 30	1.1 + 30	1.1 + 45	3.6 + 45
	3 V	0.0001 V	0.7 + 25	1.1 + 30	1.6 + 30	2.1 + 45	3.6 + 45
	30 V	0.001 V	0.7 + 25	1.1 + 30	1.6 + 30	2.1 + 45	3.6 + 45
	300 V	0.01 V	0.7 + 25	1.1 + 30	1.6 + 30	2.1 + 45	—
	1000 V	0.1 V	0.7 + 25	1.1 + 30	1.6 + 30	—	—

Function	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)		Burden voltage/Shunt
			45 Hz to 65 Hz	20 Hz to 2 kHz	
True RMS AC + DC Current ²	300 μ A	0.01 μ A	0.8 + 30	1.1 + 30	< 0.04 V/100 Ω
	3000 μ A	0.1 μ A	0.8 + 30	1.1 + 30	< 0.4 V/100 Ω
	30 mA	0.001 mA	0.8 + 30	1.1 + 30	< 0.08 V/1 Ω
	300 mA	0.01 mA	0.8 + 30	1.1 + 30	< 1.00 V/1 Ω
	3 A	0.0001 A	0.9 + 35	1.3 + 35	< 0.1 V/0.01 Ω
	10 A	0.001 A	0.9 + 35	1.3 + 35	< 0.3 V/0.01 Ω

1. Notes for voltage specifications:

- Overload protection: 1000 Vrms. For millivolt measurements, 1000 Vrms for short circuits with < 0.3 A current.
- Input impedance: 10 M Ω (nominal) in parallel with < 100 pF.
- For 20 to 100 kHz accuracy: Three counts of the LSD per kHz of additional error is to be added for frequencies > 20 kHz and signal inputs $< 10\%$ of range.

2. Notes for current specifications:

- Overload protection for 300 μ A to 300 mA range: 0.44 A/1000 V; 10 \times 35 mm 30 kA fast-acting fuse.
- Overload protection for 3 A to 10 A range: 11 A/1000 V; 10 \times 38 mm 30 kA fast-acting fuse.
- Specification for 300 mA range: 440 mA continuous.
- Specification for 10 A range: 10 A continuous. Add 0.3% to the specified accuracy when measuring signals > 10 to 20 A for 30 seconds maximum. After measuring currents > 10 A, cool down the multimeter for twice the duration of the measured time before proceeding with low current measurements.

Electrical Specifications

Temperature specifications¹⁻⁶

Thermocouple type	Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)		
			U1271A	U1272A	U1273A
K	-200 to 1372 °C	0.1 °C	1% + 1 °C	1% + 1 °C	1% + 1 °C
	-328 to 2502 °F	0.1 °F	1% + 1.8 °F	1% + 1.8 °F	1% + 1.8 °F
J	-210 to 1200 °C	0.1 °C	—	1% + 1 °C	1% + 1 °C
	-346 to 2192 °F	0.1 °F	—	1% + 1.8 °F	1% + 1.8 °F

1. The specifications above is specified after 60 minutes of warm-up time.
2. The accuracy does not include the tolerance of the thermocouple probe.
3. Do not allow the temperature sensor to contact a surface that is energized above 30 Vrms or 60 V DC. Such voltages pose a shock hazard.
4. Ensure that the ambient temperature is stable within ± 1 °C and that the Null function is used to reduce the test lead's thermal effect and temperature offset. Before using Null function, set the multimeter to measure temperature without ambient compensation (°C) and keep the thermocouple probe as close to the multimeter as possible (avoid contact with any surface that has a different temperature from the ambient temperature).
5. When measuring temperature with respect to any temperature calibrator, try to set both the calibrator and multimeter with an external reference (without internal ambient compensation). If both the calibrator and multimeter are set with internal reference (with internal ambient compensation), some deviations may show between the readings of the calibrator and multimeter, due to differences in ambient compensation between the calibrator and multimeter. Keeping the multimeter close to the output terminal of calibrator will help reduce the deviation.
6. The temperature calculation is specified according to the safety standards of EN/IEC-60548-1 and NIST175.

Capacitance specifications^{7,8}

Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)		
		U1271A	U1272A	U1273A
10 nF	0.001 nF	1 + 5	1 + 5	1 + 5
100 nF	0.01 nF	1 + 2	1 + 2	1 + 2
1000 nF	0.1 nF	1 + 2	1 + 2	1 + 2
10 μ F	0.001 μ F	1 + 2	1 + 2	1 + 2
100 μ F	0.01 μ F	1 + 2	1 + 2	1 + 2
1000 μ F	0.1 μ F	1 + 2	1 + 2	1 + 2
10 mF	0.001 mF	1 + 2	1 + 2	1 + 2

7. Overload protection: 1000 Vrms for short circuits with < 0.3 A current.
8. The accuracy for all ranges is specified based on a film capacitor or better, and after the Null function is used to subtract the test lead resistance and thermal effect (by shorting the test leads).

Electrical Specifications

Frequency specifications^{1, 2}

Range	Resolution	Accuracy \pm (% of reading + counts of least significant digit)	Minimum input frequency
99.999 Hz	0.001 Hz	0.02 + 5	0.5 Hz
999.99 Hz	0.01 Hz	0.005 + 5	
9.9999 kHz	0.1 Hz	0.005 + 5	
99.999 kHz	1 Hz	0.005 + 5	
999.99 kHz	0.01 kHz	0.005 + 5	
> 1 MHz	0.1 kHz	0.005 + 5 @ < 1 MHz	
10 mF	0.001 mF	1 + 2	

1. Overload protection: 1000 V; input signal is $< 20,000,000 \text{ V} \times \text{Hz}$ (product of voltage and frequency).
2. The frequency measurement is susceptible to error when measuring low-voltage, low-frequency signals. Shielding inputs from external noise pickup is critical for minimizing measurement errors. Turning on the low pass filter may help you to filter out the noise and achieve a stable reading.

Duty Cycle³

Mode	Range	Accuracy at full scale
DC coupling	99.99%	0.3 % per kHz + 0.3 %
AC coupling	99.99%	0.3 % per kHz + 0.3 %

3. Notes for duty cycle specifications:
 - The accuracy for duty cycle and pulse width measurements is based on a 3 V square wave input to the DC 3 V range. For AC couplings, the duty cycle range can be measured within the range of 10% to 90% for signal frequencies > 20 Hz.
 - The range of the duty cycle is determined by the frequency of the signal: $\{10 \mu\text{s} \times \text{frequency} \times 100\%\}$ to $\{[1 - (10 \mu\text{s} \times \text{frequency})] \times 100\%\}$.
 - The pulse width (positive or negative) must be > 10 μs . The range of the pulse width is determined by the frequency of the signal.

Pulse Width⁴

Range	Resolution	Accuracy at full scale
999.99 ms	0.01 ms	(duty cycle accuracy/frequency) + 0.01 ms
2000.0 ms	0.1 ms	(duty cycle accuracy/frequency) + 0.1 ms

4. Notes for pulse width specifications:
 - The accuracy for duty cycle and pulse width measurements is based on a 3 V square wave input to the DC 3 V range.
 - The pulse width (positive or negative) must be > 10 μs . The range of the pulse width is determined by the frequency of the signal.

Electrical Specifications

U1271A and U1272A frequency sensitivity for voltage measurements^{1, 2, 3}

Input range	Minimum sensitivity (RMS sine wave)			Trigger level for DC coupling	
	15 Hz to 100 kHz	0.5 Hz to 200 kHz	Up to 1 MHz	0.5 Hz to 200 kHz	
				U1271A	U1272A
30 mV	3 mV	3 mV	—	—	5 mV
300 mV	6 mV	8 mV	40 mV	10 mV	15 mV
3 V	0.12 V	0.2 V	0.4 V	0.15 V	0.15 V
30 V	0.6 V	0.8 V	2.6 V	1.5 V	1.5 V
300 V	6 V	8 V @ < 100 kHz	—	9 V @ < 100 kHz	9 V @ < 100 kHz
1000 V	50 V	50 V @ < 100 kHz	—	90 V @ < 100 kHz	90 V @ < 100 kHz

1. Maximum input for specified accuracy, refer to "AC specifications" on page 11.

2. 30 mV range applicable for U1272A only.

3. 200 kHz to 1 MHz range applicable for U1272A only.

U1273A sensitivity for voltage measurements⁴

Input range	Frequency sensitivity and trigger level		
	Minimum sensitivity (RMS sine wave)	Trigger level for DC coupling	
Maximum input for specified accuracy, refer to AC voltage	15 Hz to 100 kHz	0.5 Hz to 200 kHz	Up to 1 MHz
30 mV	3 mV	3 mV	—
300 mV	7 mV	8 mV	38 mV
3 V	0.12 V	0.12 V	0.48 V
30 V	0.8 V	0.8 V	3.5 V
300 V	6.7 V	8 V < 100 kHz	—
1000 V	67 V	67 V < 100 kHz	—
			110 V < 100 kHz

4. Maximum input for specified accuracy, refer to "AC specifications" on page 11.

Frequency sensitivity for current measurements⁵

Input range	Minimum sensitivity (RMS sine wave)	
	2 Hz to 30 kHz	
	U1271A/U1272A	U1273A
300 µA	100 µA	70 µA
3000 µA	70 µA	120 µA
30 mA	1.2 mA	1.2 mA
300 mA	12 mA	12 mA
3 A	0.12 A	0.12 A
10 A	1.2 A	1.2 A

5. Maximum input for specified accuracy, refer to "AC specifications" on page 11.

Peak hold

Signal width	Accuracy for DC Voltage and Current
Single event >1 ms	Specified accuracy + 400
Repetitive >250 µs	Specified accuracy + 1000

Electrical Specifications

Decibel (dB) for U1272A and U1273A^{1, 2, 3}

dB base	Reference	Default reference
1 mW (dBm)	1 to 9999 Ω	50 Ω
1 V (dBV)	1 V	1 V

1. The reading of dBm is indicated in decibels of power above or below 1 mW, or decibels of voltage above or below 1 V. The formula is calculated according to the voltage measurement and specified reference impedance. Its accuracy is depended on the accuracy of the voltage measurement. See Decibel (dBV) accuracy table below.
2. Auto-ranging mode is used.
3. The bandwidth is according to voltage measurement.

Decibel (dBV) accuracy

Range	dBV range		Accuracy					
	Minimum	Maximum	45 Hz to 65 Hz	20 Hz to 1 kHz	1 Hz to 5 kHz	5 kHz to 20 kHz	20 Hz to 100 kHz	
30 mV	-56.48	-30.46	0.06	0.07	0.09	0.1	0.32	
300 mV	-36.48	-10.46	0.06	0.07	0.09	0.1	0.32	
3 V	-16.48	+9.54	0.06	0.09	0.14	0.19	0.32	
30 V	+3.52	+29.54	0.06	0.09	0.14	0.19	0.32	
300 V	+23.52	+49.54	0.06	0.09	0.14	0.19	—	
1000 V	+33.98	+60	0.06	0.09	0.14	—	—	

Measurement rate (approximate)

Function	Times/second	
	U1271A	U1272A/U1273A
ACV	7	7
DCV	7	7
Ω	14	14
Ω with offset compensation	-	3
Diode	14	14
Auto Diode	-	3
Capacitance	4 (< 100 µF)	4 (< 100 µF)
DCA	7	7
ACA	7	7
Temperature	7	7
Frequency	2 (> 10 Hz)	2 (> 10 Hz)
Duty cycle	1 (> 10 Hz)	1 (> 10 Hz)
Pulse width	1 (> 10 Hz)	1 (> 10 Hz)

Ordering Information



U1271A

U1272A

U1273A

Standard shipped accessories

Standard test leads, test probes with 4-mm tips, K-type thermocouple and adapter, 4x AAA batteries, Certificate of Calibration, UK 6 (test report), Quick Start Guide

Optional accessories

Measuring accessories (non-temperature)

U1161A

Extended test lead kit



Includes two test leads (red and black), two test probes, medium-sized alligator clips and 4-mm banana plugs.

- Test leads: CAT II 1000 V, 15 A
- Test probes: CAT III 1000 V, 15 A
- Medium-sized alligator clips: CAT III 1000 V/CAT IV 600 V, 10 A
- 4-mm banana plugs: CAT II 600 V, 10 A

U1162A

Alligator clips



- One pair of insulated alligator clips (red and black). Recommended for use with Agilent standard test leads.

• Rated CAT III 1000 V, 10 A

U1163A

SMT grabbers



- One pair of SMT grabbers (red and black). Recommended for use with Agilent standard test leads.

• Rated CAT II 300 V, 3 A

U1164A

Fine-tip test probes



- One pair of fine-tip test probes (red and black). Recommended for use with Agilent standard test leads.

• Rated CAT II 300 V, 3 A

U1168A

Standard test lead kit



Includes two test leads (red and black), 4-mm test probes, alligator clips, fine-tip test probes, SMT grabbers and mini grabber (black).

- Test leads: CAT III 1000 V, CAT IV 600 V, 15 A
- Test probe (19-mm tips): CAT II 1000 V, 15 A
- Test probes (4-mm tip): CAT III 1000 V, CAT IV 600 V, 15 A
(highly recommended for CAT IV environment)
- Alligator clips: CAT III 1000 V, 10 A, CAT IV 600 V, 10 A
- Fine-tip test probes: CAT II 300 V, 3 A
- SMT grabber: CAT II 300 V, 3 A
- Mini grabber: CAT II 300 V, 3 A

U1583B

AC current clamp



- Dual range: 40 A and 400 A

• Rated CAT III 600 V

• BNC-to-banana-plug adapter provided for use with DMMs

Ordering Information

Optional accessories

Measuring accessories (temperature)

U1180A

Thermocouple
adapter+lead kit,
J and K types



Includes thermocouple adapter, thermocouple bead J-type and thermocouple bead K-type.

- T/C adapter J/K-type
- T/C bead J-type: -20 °C to 200 °C
- T/C bead K-type: -20 °C to 200 °C

U1181A

Immersion
temperature probe



- Type-K T/C for use in oil and other liquids

• Measurement range: -50 °C to 700 °C

• Includes adapter U1184A for connection to DMM

U1182A

Industrial surface
temperature probe



- Type-K T/C for use on still surfaces

• Measurement range: -50 °C to 400 °C

• Includes adapter U1184A for connection to DMM

U1183A

Air temperature
probe



- Type-K T/C for use in air and non-caustic gas

• Measurement range: -50 °C to 800 °C

• Includes adapter U1184A for connection to DMM

U1184A

Temperature probe
adapter



- Mini-connector-to-banana-plug adapter for use with DMM

U1185A

J-type thermocouple
and adapter



- T/C adapter J/K-type

• T/C bead J-type: -20 °C to 200 °C

U1186A

K-type
thermocouple and
adapter



- T/C adapter J/K-type

• T/C bead J-type: -20 °C to 200 °C

Ordering Information

Optional accessories

Cable

U1173A
IR-to-USB cable



- For remote control and data logging to PC
- Maximum baud rate: 19,200 bits per second

U1174A
Soft carrying case



The convenient way to carry your DMM and essential accessories

- Dimension: 9 inches (H) x 5 inches (W) x 3 inches (D)

Hanging kit

U1171A
Magnetic hanging
kit



For fastening the DMM to a steel surface so both hands are free

Probe Clip Light

U1176A
LED Probe Clip Light



- 3 inches in length
- To be clipped onto test probes to increase visibility
- Comes with one AAA battery



Agilent Email Updates

www.agilent.com/find/emailupdates

Get the latest information on the products and applications you select.



www.axiestandard.org

AdvancedTCA® Extensions for Instrumentation and Test (AXIe) is an open standard that extends the AdvancedTCA for general purpose and semiconductor test. Agilent is a founding member of the AXIe consortium.



www.lxistandard.org

LAN eXtensions for Instruments puts the power of Ethernet and the Web inside your test systems. Agilent is a founding member of the LXI consortium.



www.pxisa.org

PCI eXtensions for Instrumentation (PXI) modular instrumentation delivers a rugged, PC-based high-performance measurement and automation system.

Agilent Channel Partners

www.agilent.com/find/channelpartners

Get the best of both worlds: Agilent's measurement expertise and product breadth, combined with channel partner convenience.

Agilent Advantage Services



Agilent Advantage Services is committed to your success throughout your equipment's lifetime. To keep you competitive, we continually invest in tools and processes that speed up calibration and repair and reduce your cost of ownership. You can also use Infoline Web Services to manage equipment and services more effectively. By sharing our measurement and service expertise, we help you create the products that change our world.

www.agilent.com/find/advantageservices



www.agilent.com/quality

www.agilent.com

www.agilent.com/find/handheldmm

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

www.agilent.com/find/contactus

Americas

Canada	(877) 894 4414
Brazil	(11) 4197 3500
Mexico	01800 5064 800
United States	(800) 829 4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 375 8100

Europe & Middle East

Belgium	32 (0) 2 404 93 40
Denmark	45 70 13 15 15
Finland	358 (0) 10 855 2100
France	0825 010 700*
	*0.125 €/minute
Germany	49 (0) 7031 464 6333
Ireland	1890 924 204
Israel	972-3-9288-504/544
Italy	39 02 92 60 8484
Netherlands	31 (0) 20 547 2111
Spain	34 (91) 631 3300
Sweden	0200-88 22 55
United Kingdom	44 (0) 131 452 0200

For other unlisted countries:

www.agilent.com/find/contactus

Revised: June 8, 2011

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2010, 2011
Published in USA, September 2, 2011
5990-6425EN



Agilent Technologies

Agilent U1177A

IR-to-Bluetooth Adapter

Data Sheet



Features

- Enables Bluetooth® connection to Agilent handheld digital multimeters
- Easy to install by attaching to Infrared (IR) port located at the back of Agilent handheld digital multimeters
- Compatible with Agilent U1230 series, U1240 series, U1250 series and U1270 series handheld digital multimeters
- Operated by two 1.5 V AAA batteries

Agilent U1177A Infrared (IR)-to-Bluetooth® adapter offers wireless remote connectivity solution via Bluetooth® connection simply by attaching the adapter to the IR port of an Agilent handheld digital multimeter. The wireless remote connectivity is set up when an Agilent handheld digital multimeter is connected to U1177A and an Android device (tablet or smart phone) with the installed software. Every U1177A also has a unique Media Access Control (MAC) address. User can quickly and easily scan for the right U1177A using their Android device and pair up with the U1177A.

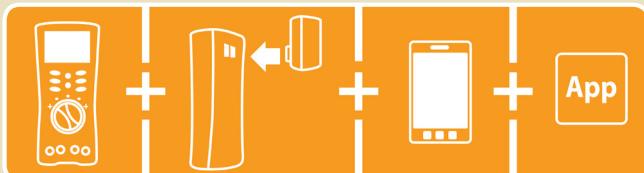


Figure 1. Agilent wireless remote connectivity solution

The Bluetooth® word mark and logos are registered trademark owned by Bluetooth SIG, Inc and any use of such marks by Agilent Technologies, Inc. is under license. Other trademark and trade names are those of their respective owners.





Take a closer look



Figure 2. The U1177A as illustrated

Perform data logging with multimeters – wirelessly!



Figure 3. Data logging with Agilent Mobile Logger software.

Data logging is an important function for industrial users to capture data streams or plotting trending graphs. These data and graphs are used for analysis to identify intermittent behavior or detect drifts. Agilent Mobile Logger is the free Android application software that logs data and provides trending graphs from Agilent handheld digital multimeters. Agilent Mobile Logger offers an array of extended functions such as sending e-mail or Short Message Service (SMS) automatically, and pan and zoom function via the Android device's touch screen. Alternatively, data logging and monitoring activities can also be performed at the comfort of one's Personal Computer (PC) via a downloadable Agilent GUI data logger software.

Notes:

1. Agilent Mobile Meter and Agilent Mobile Logger can be downloaded from www.agilent.com/find/hh-Android or from Android Market (<https://market.android.com/>)
2. Agilent GUI Data Logger Software can be www.agilent.com/find/hh-logger

Perform up to three multimeter measurements at the same time with Agilent Mobile Meter

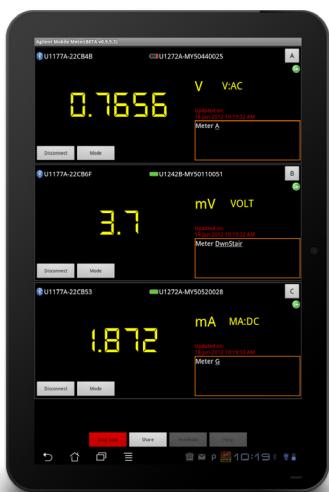


Figure 4. Up to three multimeters measurements with the Agilent Mobile Meter

Agilent Mobile Meter is a free Android application software that allows an Android device to connect, control and perform up to 3 multimeter measurements. Without the need to be physically present at various points, users can now extend their reach to two or three places. This solution allows you to make measurements from a safe distance, eliminates the need to walk back-and-forth between measure target and control points, and monitors multiple measurements simultaneously. Achieve higher work productivity when you use the U1177A with your Agilent handheld digital multimeters.

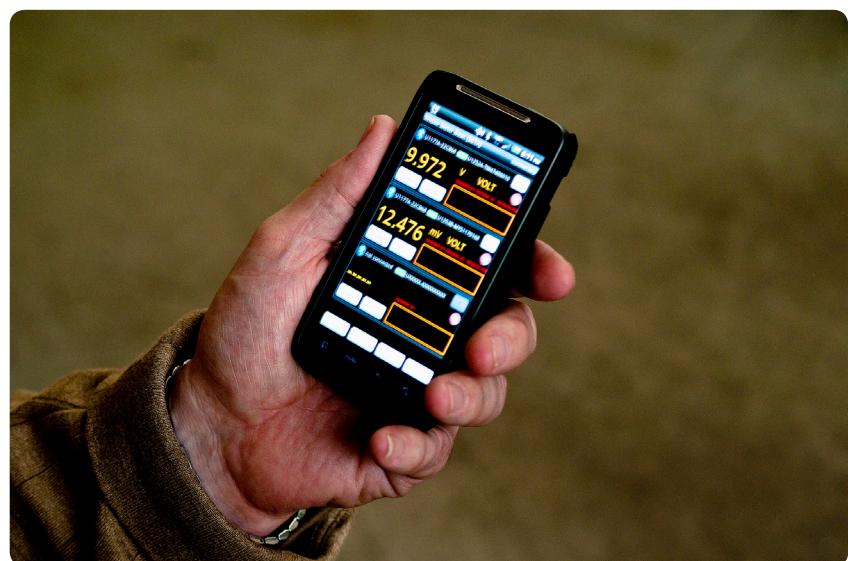


Figure 5. Make measurements with the Agilent Mobile Meter via an Android smart phone

Specifications

Product characteristics	Description
Radio specification	<ul style="list-style-type: none">• Frequency: 2402 MHz ~ 2480 MHz• Antenna Power: 1 mW or less• Number of Channels: 79• Modulation: GFSK / PSK
Operating environment	Operating temperature from -20 to 55 °C
Storage environment	Storage temperature from -40 to 70 °C
Relative humidity (R.H.)	Relative humidity up to 95% at 40 °C (non-condensing)
Power consumption	Maximum 130 mVA for two 1.5 V AAA batteries
Battery life	30 hours typical (based on continuous data transfer)
Battery type	Alkaline 24 A (ANSI/NEDA) and LR03 (IEC), or Zinc Chloride 24 D (ANSI/NEDA) and R03 (IEC)
Dimension (W x H x L)	39.0 × 71.0 × 37.0 mm
Weight	60 g with batteries
Warranty	Three months
Bluetooth	"Bluetooth" Version 2.1 + EDR compliant, SPP profile, Class 2 device (with 10 metres connection range)
Safety	The U1177A complies with the requirements of the following safety and regulation standards: <ul style="list-style-type: none">• FCC Part15C (Certification) (15.209, 15.247) FCC ID: ZKMAGILENT-U1177A• FCC Part15B (DoC) (15.109)• RSS-210 Issue 8:2010 IC: 6310A-U1177A• ICES-003 Issue 4:2004• EN 300 328 V1.7.1:2008• EN 301 489-1V1.8.1:2008/-17 V2.11:2009• EN 55022:2006+A1:2007/EN55024:1998+A1:2001+A2:2003• EN 50371:2002• EN 60950-1:2006/A11:2009/A1:2010• Complies with IDA Standards (DB 102425)• India Equipment Type Approval (ETA) Certificate No: 1424/2011/WRLO• COFETEL Certificate No: RCPAGU111-1066, registered under Agilent Technologies Mexico S de RL de CV

"This telecommunication equipment conforms NTC technical requirement"



Standard shipped items:

- Two 1.5 V AAA batteries
- Operating instructions

 **Agilent Email Updates**

www.agilent.com/find/emailupdates

Get the latest information on the products and applications you select.



www.axiestandard.org

AdvancedTCA® Extensions for Instrumentation and Test (AXIe) is an open standard that extends the AdvancedTCA for general purpose and semiconductor test. Agilent is a founding member of the AXIe consortium.



www.lxistandard.org

LAN eXtensions for Instruments puts the power of Ethernet and the Web inside your test systems. Agilent is a founding member of the LXI consortium.



www.pxisa.org

PCI eXtensions for Instrumentation (PXI) modular instrumentation delivers a rugged, PC-based high-performance measurement and automation system.

Agilent Channel Partners

www.agilent.com/find/channelpartners

Get the best of both worlds: Agilent's measurement expertise and product breadth, combined with channel partner convenience.

Agilent
Advantage
Services 

Agilent Advantage Services is committed to your success throughout your equipment's lifetime. To keep you competitive, we continually invest in tools and processes that speed up calibration and repair and reduce your cost of ownership. You can also use Infoline Web Services to manage equipment and services more effectively. By sharing our measurement and service expertise, we help you create the products that change our world.

www.agilent.com/find/advantageservices



www.agilent.com/quality

For more information on Agilent Technologies' products, applications or services, please contact your local Agilent office. The complete list is available at:

www.agilent.com/find/contactus

Americas

Canada	(877) 894 4414
Brazil	(11) 4197 3600
Mexico	01800 5064 800
United States	(800) 829 4444

Asia Pacific

Australia	1 800 629 485
China	800 810 0189
Hong Kong	800 938 693
India	1 800 112 929
Japan	0120 (421) 345
Korea	080 769 0800
Malaysia	1 800 888 848
Singapore	1 800 375 8100
Taiwan	0800 047 866
Other AP Countries	(65) 375 8100

Europe & Middle East

Belgium	32 (0) 2 404 93 40
Denmark	45 45 80 12 15
Finland	358 (0) 10 855 2100
France	0825 010 700*
	*0.125 €/minute
Germany	49 (0) 7031 464 6333
Ireland	1890 924 204
Israel	972-3-9288-504/544
Italy	39 02 92 60 8484
Netherlands	31 (0) 20 547 2111
Spain	34 (91) 631 3300
Sweden	0200-88 22 55
United Kingdom	44 (0) 118 927 6201

For other unlisted countries:

www.agilent.com/find/contactus

Revised: January 6, 2012

Product specifications and descriptions in this document subject to change without notice.

© Agilent Technologies, Inc. 2012
Published in USA, February 2, 2012
5990-9531EN



Agilent Technologies